

Section Inspection - 2/04/2026 - NP237288

2/04/2026	7:38 AM	Land ownership Public land	Pipe Asset ID NP237288	Nr. 1
Project name 2026_04_02_SW_JEFF_South Brisbane_CCTV28	Contract No.	Coding Standard WSA 2020	Name of operator Daniel Cornwell	Job ID 01

Address Dorchester St	US MH 01	Total Length 0.00 m
Location type In a road	Direction Not known	GIS Length 0.00 m
Operation Gravity	DS MH 02	Inspected Length [m] 16.12 m
	Use Combined system	Year Laid
Profile 150mm	Purpose of inspection Routine inspection of condition	
Lining material	Method of inspection Inspection from the access structure only	
Lining type	Precipitation	
Dia/Height 150 mm	Cleaning The conduit was cleaned prior to the inspection	
Material Polyvinylchloride	Flow control No measures taken	
General comment		

**BCC DS
RECEIVED**
16/07/2026
APPLICATION REF
A006914469

1:141	m+	Code	Observation Text	Grade
	0.00	GC	General comment / Works recorded for Jeff to plan work ahead	
	0.00	GC	General comment / Pipe size changes size from 200-300 immediatley	
	0.00	WLN	No water flow	
	2.10	JDSZ	Defective seal joint, other defect from 10 o'clock to 2 o'clock / Exposed material at join	
	2.10	BM	Breaking, one or more pieces of conduit are missing, length of break: 100mm from 10 o'clock to 2 o'clock	3
	4.02	BM	Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 1 o'clock / Sand bag used for fill	3
	4.02	CC	Circumferential cracking, at joint, width: 3mm from 9 o'clock to 3 o'clock	3
	5.86	JDR	Joint displaced radially, radial displacement: 5mm at 6 o'clock	1
	11.32	BM	Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 1 o'clock / Exposed rio	3
	12.46	BM	Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 12 o'clock / Exposed rio	3
	12.46	VV	Void visible through defect	
	16.12	FHO	Finish node, outfall or culvert headwall, Nodename:, 02	



GC - 0.00




GC - 0.00



WLN - 0.00



JDSZ - 2.10

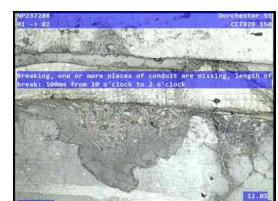

BM - 2.10

Section Inspection - 2/04/2026 - NP237288

2/04/2026	7:38 AM	Land ownership Public land	Pipe Asset ID NP237288	Nr. 1
Project name 2026_04_02_SW_JEFF_South Brisbane_CCTV28	Contract No.	Coding Standard WSA 2020	Name of operator Daniel Cornwell	Job ID 01



BM - 2.10



BM - 4.02



CC - 4.02



CC - 4.02



JDR - 5.86



JDR - 5.86



BM - 11.32



BM - 11.32



BM - 12.46



VV - 12.46



VV - 12.46



FHO - 16.12

Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Defects				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
5	40.0	6.2	100.0	4	1	1.0	0.1	1.0	1

Section Pictures - 2/04/2026 - NP237288

Suburb South Brisbane	Address/Location Dorchester St	2/04/2026	Pipe Asset ID NP237288	Job ID 01
---------------------------------	--	------------------	----------------------------------	---------------------




1, 00:00:00, 0.00
General comment / Works recorded for Jeff to plan work ahead



2, 00:00:17, 0.00
General comment / Pipe size changes size from 200-300 immediatley



3, 00:00:21, 0.00
No water flow

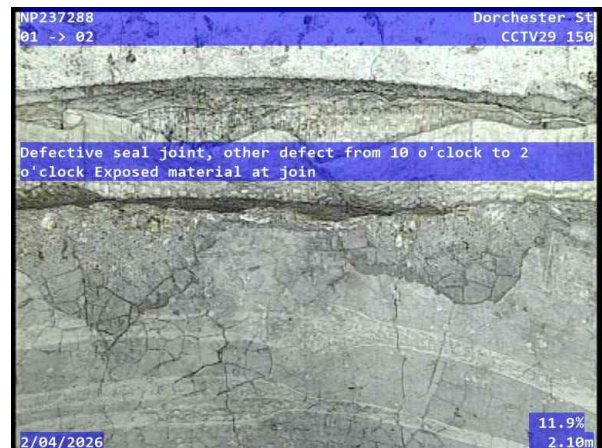

4, 00:01:33, 2.10
Defective seal joint, other defect from 10 o'clock to 2 o'clock / Exposed material at join



5, 00:01:13, 2.10
Breaking, one or more pieces of conduit are missing, length of break: 100mm from 10 o'clock to 2 o'clock



6, 00:01:13, 2.10
Breaking, one or more pieces of conduit are missing, length of break: 100mm from 10 o'clock to 2 o'clock

Section Pictures - 2/04/2026 - NP237288

Suburb South Brisbane	Address/Location Dorchester St	2/04/2026	Pipe Asset ID NP237288	Job ID 01
---------------------------------	--	------------------	----------------------------------	---------------------



7, 00:02:01, 4.02
Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 1 o'clock / Sand bag used for



8, 00:02:10, 4.02
Circumferential cracking, at joint, width: 3mm from 9 o'clock to 3 o'clock




9, 00:02:10, 4.02
Circumferential cracking, at joint, width: 3mm from 9 o'clock to 3 o'clock



10, 00:03:28, 5.86
Joint displaced radially, radial displacement: 5mm at 6 o'clock



11, 00:03:28, 5.86
Joint displaced radially, radial displacement: 5mm at 6 o'clock

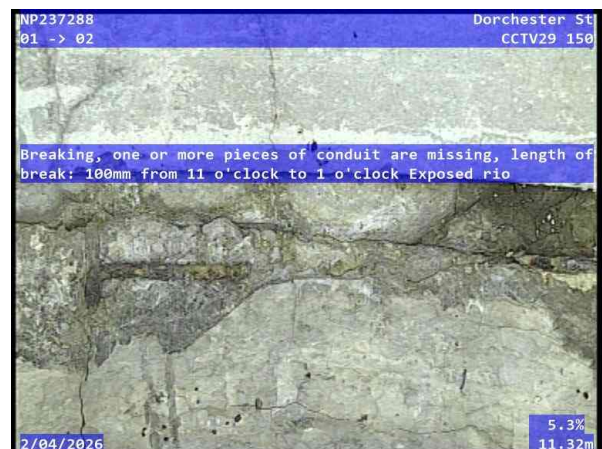


12, 00:05:00, 11.32
Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 1 o'clock / Exposed rio

Section Pictures - 2/04/2026 - NP237288

Suburb South Brisbane	Address/Location Dorchester St	2/04/2026	Pipe Asset ID NP237288	Job ID 01
---------------------------------	--	------------------	----------------------------------	---------------------



13, 00:05:00, 11.32
Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 1 o'clock / Exposed rio

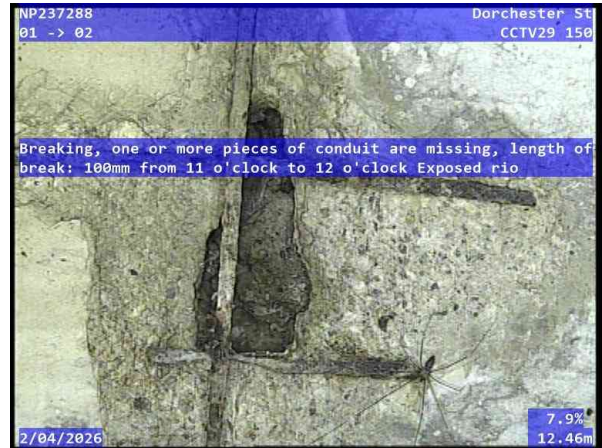

14, 00:05:53, 12.46
Breaking, one or more pieces of conduit are missing, length of break: 100mm from 11 o'clock to 12 o'clock / Exposed rio



15, 00:06:01, 12.46
Void visible through defect



16, 00:06:01, 12.46
Void visible through defect



17, 00:08:18, 16.12
Finish node, outfall or culvert headwall, Nodename:, 02

Section Inclination - 2/04/2026 - NP237288

Pipe Asset ID NP237288	Start Date 2/04/2026	Start Time 7:38 AM	Name of operator Daniel Cornwell	Suburb South Brisbane	Address/Location Dorchester St	Inspection Direction Not known
Shape	Dia/Height 150 mm	Width 150 mm	US MH 01	DS MH 02	US Pipe Height 0.00 m	DS Pipe Height 0.00 m
Class A ≤ 45 mm	Class B ≤ 65 mm	Class C ≤ 85 mm	Measured Distance 16.06 m	Measured Inc -7.22 %	Required Inc 0.00 m	Class

Inclination

